


GENERAL INFORMATION

Your Glazer™ 1500 is shipped with the handle intact. Before using machine please refer to Form L2077 for instructions on proper handle setup.

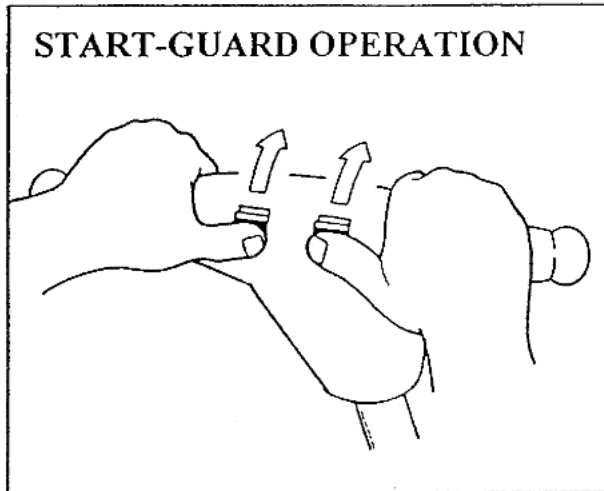

OPERATION

When starting the machine, tilt back on rear wheels so the pad is not resting on the floor surface. Grasp handles tightly to counter act the high starting torque. With thumbs push Start-Guard switches forward while simultaneously squeezing handle levers. Once the machine has started, press downward on floor surface. After initial start, machine is easy to control. A circuit breaker is located on the base of the machine. Should an overload occur; attempt to locate the cause and reset the breaker by pressing the black button (located on the circuit breaker housing).

POLISHING

Use 3/4" to 1" thick high speed burnishing pads. Floors should be dry mopped to remove grit. Start at point nearest electrical outlet and walk in a straight line as far as cable will allow. Then turn 180 degree-
saway from the cable and machine in a path parallel to to, and slightly overlapping the first pass.

SPRAY BUFFING

Use 3/4" to 1" thick burnishing pad. The spray buff solution should be applied to the floor ahead of the machine. Do not run the machine into the spray or mist of the spray buff solution. Use the same straight line technique described in the Polishing section.

DAMP BUFFING

Use 3/4" to 1" thick burnishing pad. Use a well wrung out mop to apply a damp buffing solution. Go over dampened surface with machine until surface is dry and has a high glaze.

STORING

Store with the pad off of the floor by tilting machine back on the support wheels.